Technical Service BULLETIN

November 14, 2006

Title:

NAVIGATION SYSTEM SHOWS VEHICLE IN WRONG LOCATION

Models:

'06 – '07 4Runner & Sienna & '07 Camry, Camry HV, & Solara

Introduction

Some customers may experience a condition with their navigation system, where the vehicle icon is intermittently shown on the map in the wrong location. A special DVD map disc with a revised operating system has been developed to remedy this condition.

NOTE:

If the customer has purchased a Gen 5 update disc after November 1, 2006, then this TSB is <u>NOT</u> applicable.

Applicable Vehicles

- 2006 2007 model year 4Runner and Sienna vehicles equipped with the Toyota Navigation System produced BEFORE the Production Change Effective VINs shown in this TSB.
- 2007 model year Camry, Camry HV, and Solara vehicles equipped with the Toyota Navigation System produced BEFORE the Production Change Effective VINs shown in this TSB.

Parts Information

| PREVIOUS PART NUMBER | CURRENT PART NUMBER | PART NAME | QTY |
|----------------------|---------------------|---------------------|-----|
| 86271-53020 | Same | Navigation Map Disc | 1 |

Warranty Information

| OP CODE | DESCRIPTION | MODEL | TIME | OFP | T1 | T2 |
|---------|----------------|---------|------|-------------|----|----|
| | | 4Runner | 0.2 | 86271–53020 | 87 | 74 |
| EL5081 | R & R Map Disc | Camry | 0.2 | | | |
| | | Sienna | 0.2 | | | |

Applicable Warranty*:

This repair is covered under the Toyota Comprehesive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

^{*} Warranty application is limited to correction of a problem based upon a customer's specific complaint.

Production Change Information

| MODEL | PLANT | MODEL CODE | PRODUCTION CHANGE EFFECTIVE VIN |
|----------|-----------|------------|---------------------------------|
| | Tahara | GRN210 | JTEZU1#R#70085514 |
| | Hino | GRNZIU | JTEZU1#R#78067896 |
| | Tahara | ODNOAS | JTEBU1#R#70108416 |
| 40 | Hino | GRN215 | JTEBU1#R#78078993 |
| 4Runner | Tahara | 1171040 | JTEZT1#R#70027617 |
| | Hino | UZN210 | JTEZT1#R#78010828 |
| | Tahara | LIZNOAE | JTEBT1#R#70065195 |
| | Hino | UZN215 | JTEBT1#R#78037890 |
| | Tsutsumi | | JTNBE46K373051401 |
| | Th 40 417 | ACV40 | 4T1BE46K#7U065422 |
| Commi | TMMK | | 4T1BK46K#7U017837 |
| Camry | Tsutsumi | | JTNBK46K#73013054 |
| | TMMK | GSV40 | 4T1BE46K#7U579910 |
| | | | 4T1BK46K#7U520540 |
| Camry HV | Tsutsumi | AHV40 | JTNBB46K#73021959 |
| Sianna | ТММІ | MCL20 | 5TDZA2#C#6S546073 |
| Sienna | | MCL25 | 5TDBA2#C#6S073187 |
| Colore | ТММК | ACV30 | 4T1CE30P#7U755317 |
| Solara | | MCV31 | 4T1FA38P#7U116237 |

Identification Method

The map disc supplier part number changed to 5–464210–092. Refer to the following illustration to locate the supplier's part number (directly below the OEM part number):



Repair Procedure

- Order a navigation map disc through DENSO by calling 1–888–285–4236.
 When ordering this special map disc, provide DENSO the TSB number, dealer code, and vehicle information.
- Replace the navigation map disc.
 Refer to the Technical Information System (TIS), 2006 or 2007 model year applicable vehicle Navigation Owner's Manual: *Appendix*.
- 3. Cut the original navigation map disc in half and dispose of it.