



Technical Service BULLETIN

June 16, 2006

Title:

FRONT SEAT TRACK SQUEAK

Models:

'03 – '06 4Runner

NV005-06

NVH

TSB UPDATE NOTICE:

The information contained in this TSB supercedes TSB No. NV001-03.
TSB No. NV001-03 is now obsolete and should be discarded.

Introduction Some customers may experience a squeak/creak noise from the front driver or passenger's seat tracks. The following procedure was developed to reduce the noise.

Applicable Vehicles

- 2003 – 2006 model year 4Runner vehicles.

Parts Information

PREVIOUS PART NUMBER	CURRENT PART NUMBER	PART NAME	QTY
71120-35020	Same	Front Seat Adjuster Sub-assembly	1

Required Tools & Material

TOOLS & MATERIAL	PART NUMBER	QUANTITY
Aerosol Spray Type White Grease (or equivalent)	00289-1WG00	1

Warranty Information

OP CODE	DESCRIPTION	TIME	OFP	T1	T2
BD1063	R & R Seat Track Covers (1 Seat — 4 Track Covers)	0.1	71120-35020	91	99
Combo A	Apply White Grease to Seat Tracks (8 Apply Areas)	0.1			

Applicable Warranty*:


This repair is covered under the Toyota Comprehensive Warranty. This warranty is in effect for 36 months or 36,000 miles, whichever occurs first, from the vehicle's in-service date.

* Warranty application is limited to correction of a problem based upon a customer's specific complaint.



**Repair
Procedure**


1. Remove seat track covers.

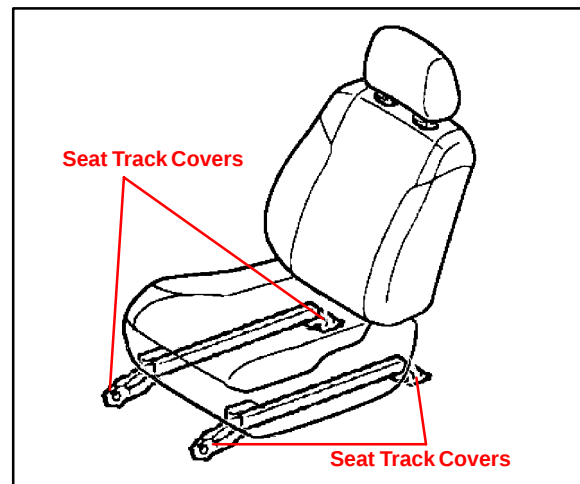

2. Apply aerosol spray type white grease between the seat track rail and bracket as shown.

NOTE:

- When applying lubricant to the seat track, cover the carpet with paper or sheet plastic to protect from overspray.
- There are a total of 8 apply areas — 2 at the front and 2 at the rear of each of the two seat tracks.

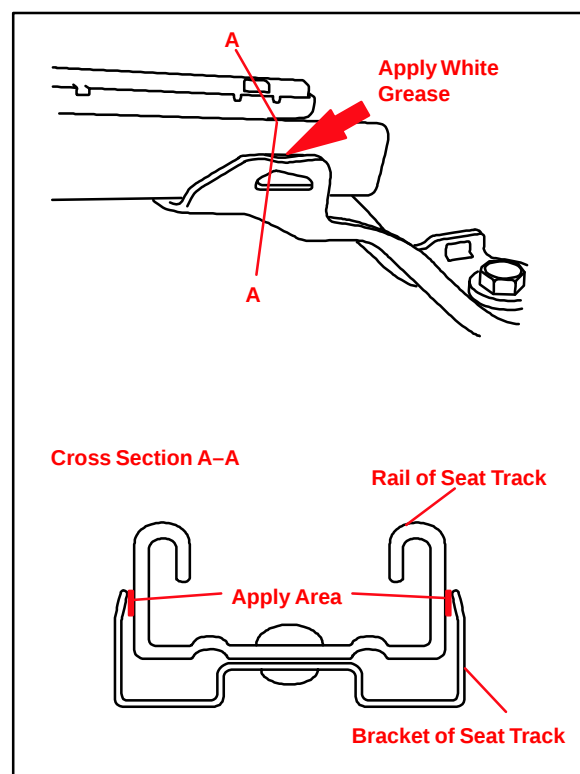

3. Reinstall seat track covers.