



4Runner (2003-2004)
Land Cruiser/LX470 (1998-2004)
Sequoia (2001-2004)
Tundra (2000-2004)

SUPERCHARGER DRIVE ASSEMBLY REPLACEMENT

Part Number: 00602-17620-471

Section I – Installation Preparation

Kit Contents

Item #	Quantity Req'd.	Description
1	1 bottle	Gear lube
2	1	Fill nozzle
3	1	Drive assembly
4	1	Fill plug
5	1 tube	Loctite Gasket Eliminator
6	1	Phenolic drive adaptor

Additional Items Required For Installation

Item #	Quantity Req'd.	Description
1	1 tube	Toyota FIPG sealant (Toyota Part Number 00295-00103)
2	1 can	Ultra Copper spray sealant
3	8	Banjo bolt gasket
4	1	Fuel injector O-ring kit

Conflicts

Note:

Tools Required

Safety Tools	
Special Tools	
Installation Tools	

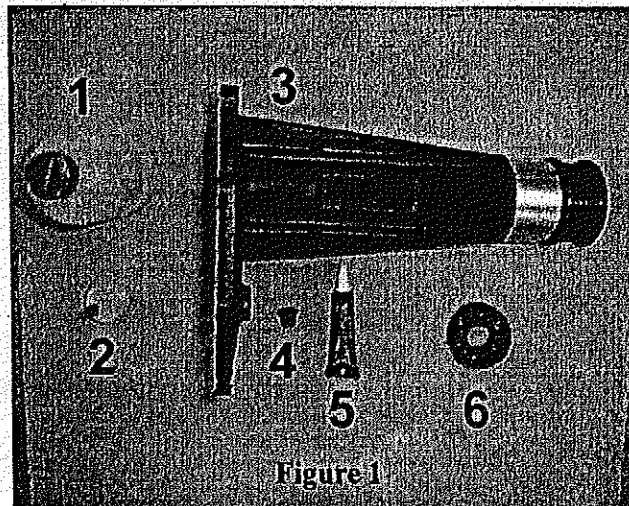


Figure 1

General Applicability

All 4.7L V8 superchargers

Notes and Recommendations

1. Read through the entire instruction set before beginning work.
2. Let the engine cool completely.
3. Clean the area around the supercharger to prevent any contamination during removal. Use compressed air to remove dirt from the engine valley.
4. Disconnect the negative battery cable from the battery.