


Last Modified: 5-10-2010	6.4 A	From: 200908
Model Year: 2010	Model: 4Runner	Doc ID: RM00000460B000X
Title: INTERIOR PANELS / TRIM: FRONT CONSOLE BOX (for 1GR-FE): REMOVAL (2010 4Runner)		

REMOVAL

1. REMOVE NO. 1 INSTRUMENT CLUSTER FINISH PANEL GARNISH

- (a) Open the instrument cluster finish panel lid.
- (b) Put protective tape around the No. 1 instrument cluster finish panel garnish.
- (c) Grip the No. 1 instrument cluster finish panel garnish and pull it diagonally upward toward the rear to detach the 5 clips and remove the No. 1 instrument cluster finish panel garnish.

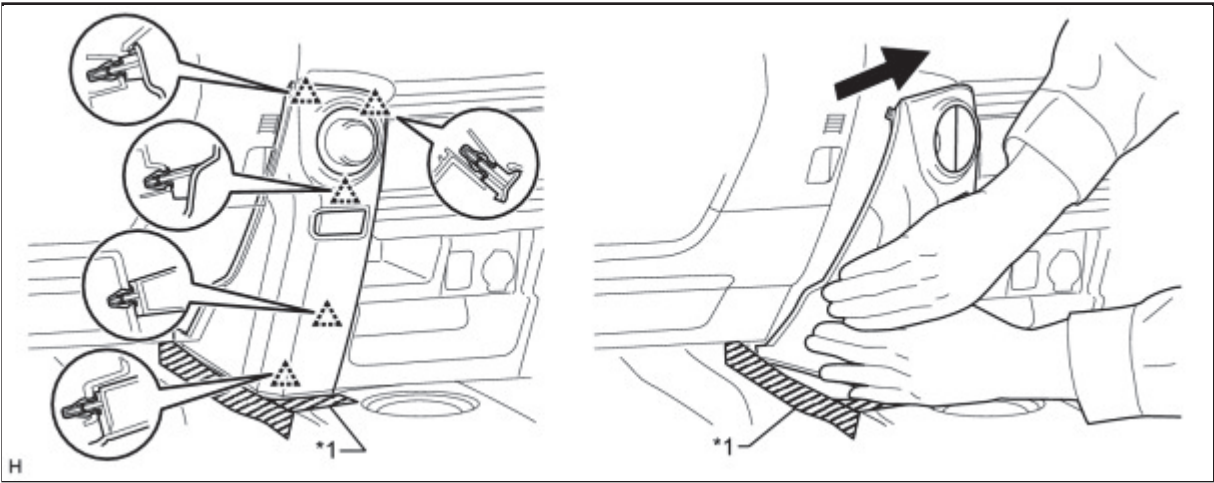


Text in Illustration

*1	Protective Tape	-	-
----	-----------------	---	---

2. REMOVE NO. 2 INSTRUMENT CLUSTER FINISH PANEL GARNISH


HINT:

Use the same procedure described for the No. 1 instrument cluster finish panel garnish.

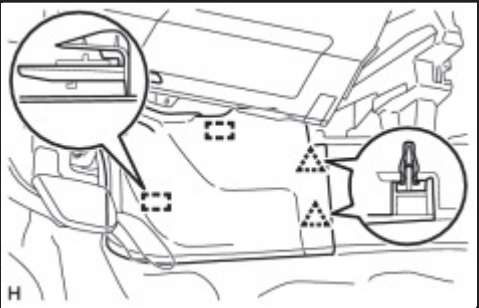


3. REMOVE FRONT NO. 1 CONSOLE BOX INSERT

- (a) Detach the 2 clips and 2 guides and remove the front No. 1 console box insert.

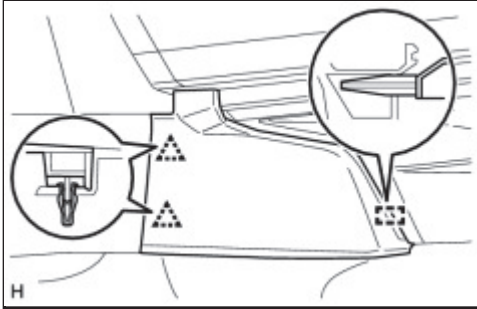


4. REMOVE FRONT NO. 2 CONSOLE BOX INSERT

- (a) Detach the 2 clips and guide and remove the front No. 2 console box insert.

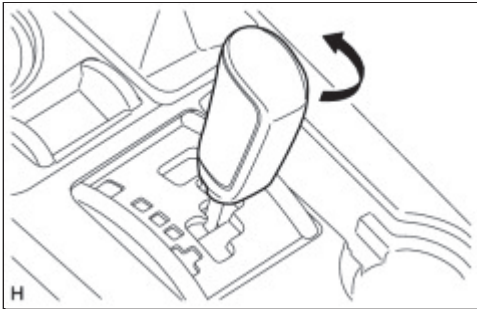

5. REMOVE SHIFT LEVER KNOB SUB-ASSEMBLY


- (a) Twist the shift lever knob in the direction indicated by the arrow and remove it.

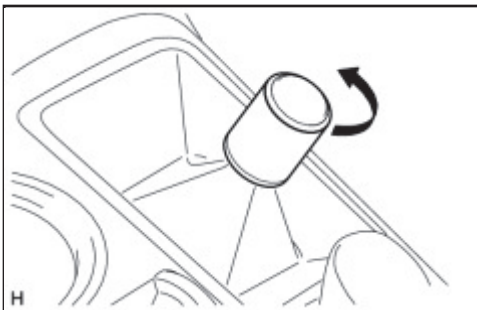

6. REMOVE SHIFT LEVER KNOB SUB-ASSEMBLY (for VF2A)

- (a) Twist the shift lever knob in the direction indicated by the arrow and remove it.

7. REMOVE UPPER CONSOLE PANEL SUB-ASSEMBLY

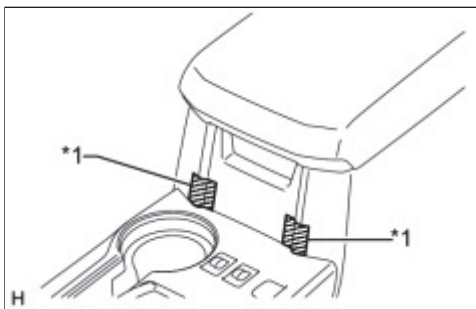


- (a) Put protective tape around the upper console panel.

Text in Illustration


* 1	Protective Tape
-----	-----------------

- (b) Using a moulding remover, detach the 10 clips.
- (c) Disconnect each connector and remove the upper console panel.

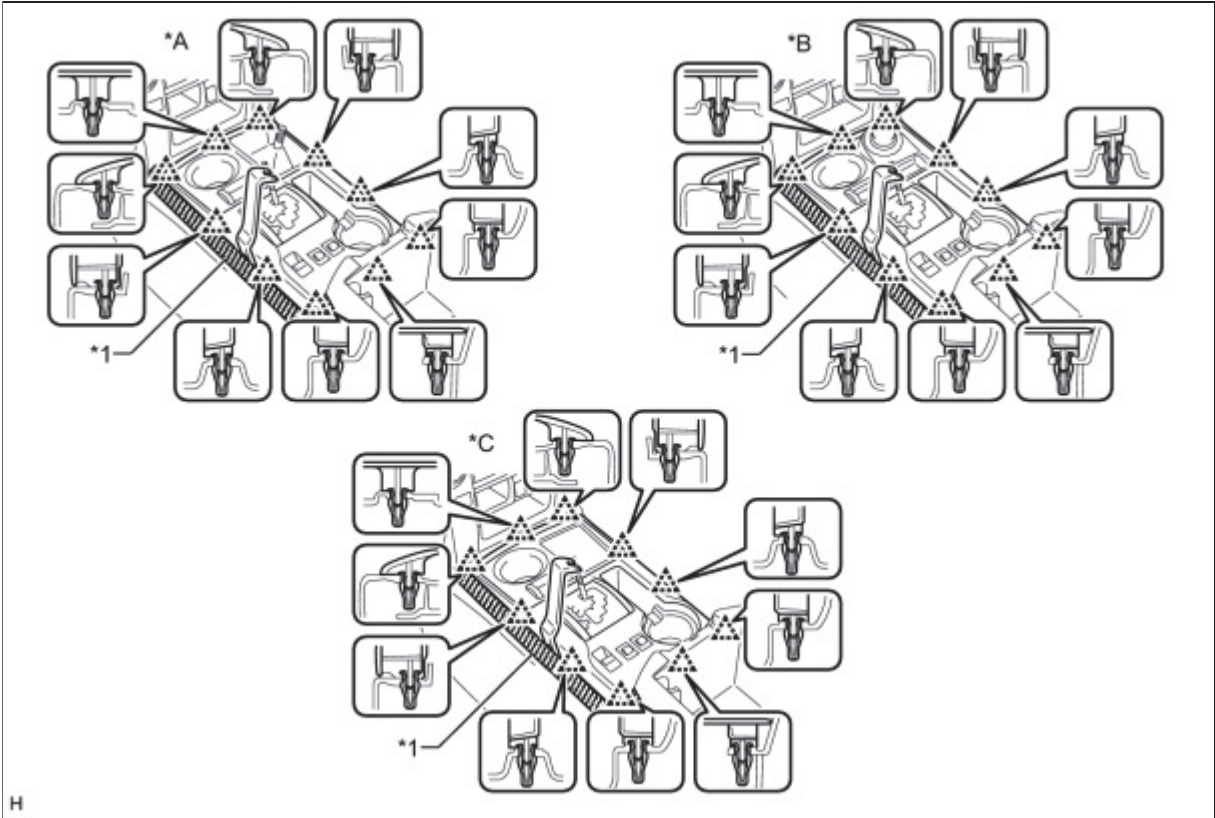


Text in Illustration

* A	for VF2A	* B	for VF4BM
* C	for 2WD	-	-
* 1	Protective Tape	-	-

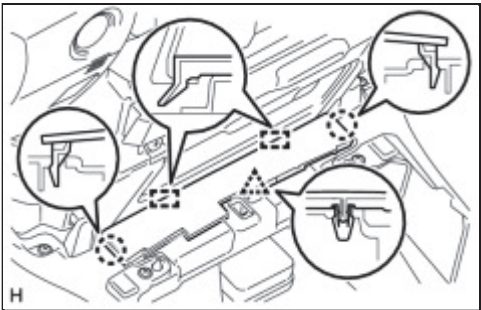

8. REMOVE NO. 2 CONSOLE BOX RETAINER

- (a) Detach the clips, 2 claws and 2 guides and remove the No. 2 console box retainer.

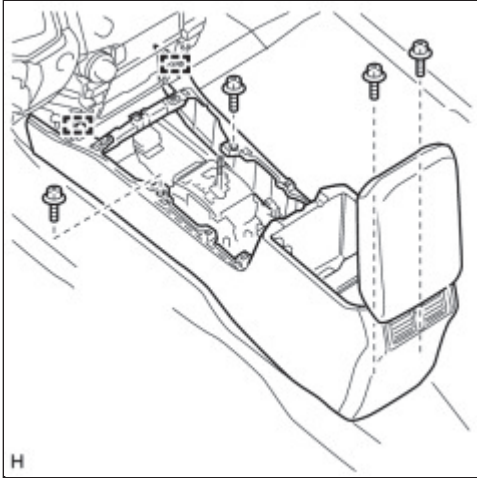

9. REMOVE REAR CONSOLE BOX ASSEMBLY

- (a) Remove the 4 bolts.
- (b) Detach the 2 guides.
- (c) Disconnect each connector and remove the rear console box.